
wattyl

ULTRA

DATA SHEET D13.1

PREMIUM CEILING HIGH OPACITY WHITE

RESOURCE CODE 43151109 APRIL 2024 PAGE 1 OF 3

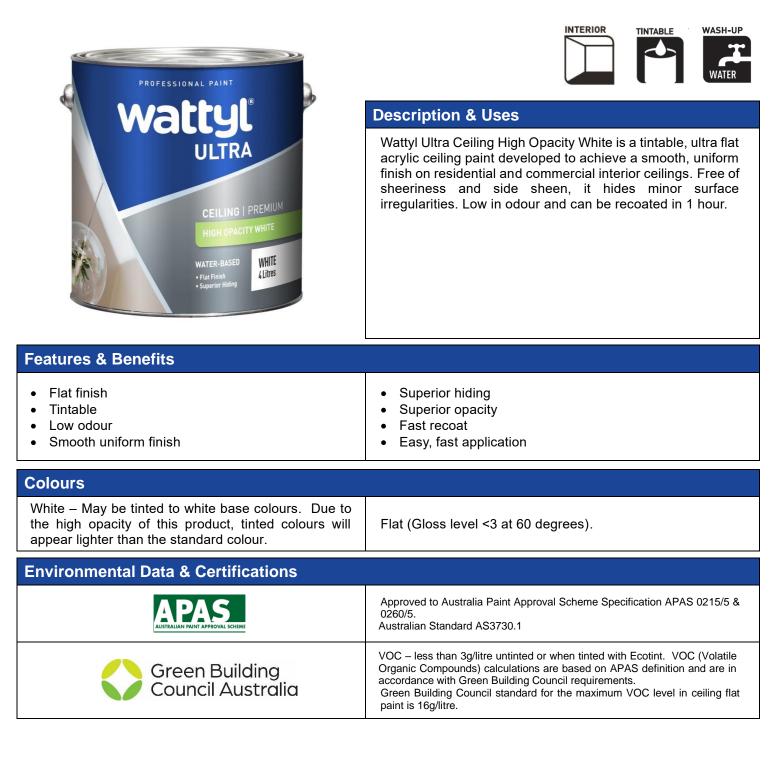

wattyl

ULTRA

DATA SHEET D13.1

PREMIUM CEILING HIGH OPACITY WHITE

RESOURCE CODE 43151109 APRIL 2024 PAGE 2 OF 3

| Properties & Performance Guide | |
|----------------------------------|--|
| Dry & Recoat Times | Surface Dry - 30 minutes Recoat - 1 hour Fully Cured - 7 days Figures are quoted at 25°C and at 50% humidity. Drying will take longer at lower temperatures or higher relative humidity. |
| Coverage per Coat | Up to 14 M ² /L depending on the surface texture, porosity and method of application. |
| Film Thickness | Wet Film Thickness (WFT) - 75 microns minimum Dry Film Thickness (DFT) - 18 microns minimum |
| Thinning | Thinning is generally not required. If necessary to aid spray atomisation, thin with up to 5% water. |
| Clean Up | Clean up with cold water away from drains. Protect Our Environment: Do not pour leftover paint down the drain. To dispose of unwanted paint see paintback.com.au. Empty paint containers should be left open in a well ventilated area to dry out. When dry, recycle containers via recycling programs. Check with your local council first. |
| VOC (Volatile Organic Compounds) | VOC < 3g/Litre. The VOC level has been calculated theoretically from raw material information in accordance with APAS D181. |

Recommended Substrate Conditions & Preparation

Surfaces are to be suitably prepared in accordance with proper trade practices.

Ensure the surface is clean, dry and free from dust, dirt and grease. All loose, peeling or flaking material must be removed. Sand enamel painted surfaces to remove gloss. Fill holes and cracks with a suitable filler and sand lightly to an even finish.

All new cement surfaces need to be fully cured (typically 4–6 weeks) prior to painting. Ensure surfaces are free of bond breakers, formwork release agents and curing compounds.

If mould is present, clean surface with household bleach then rinse well with clean water.

Test soundness of previously painted surfaces by cutting a small X in the paint with a sharp blade. Stick a piece of tape firmly over the X and pull off. If the paint pulls away, the surface is unsound. Repeat at random in a number of areas. Unsound surfaces should be stripped for best results.

Application Guide

Stir well before and during use with a broad paddle reaching to the bottom of the can and using an upward lifting action.

Apply two full, even coats by brush, roller or spray.

Use a quality synthetic brush or synthetic roller. Use a medium nap (12mm pile) synthetic roller on smooth and semismooth surfaces. Use a longer nap (20mm pile) synthetic roller on rough surfaces, e.g. Besser Block. Use a 13 or 15 thou Tip for airless spray.

Do not apply when temperature is below 10°C or above 35°C or when humidity is very high.

| Surface Type | Preparatory Coats |
|---|--|
| Previously painted surfaces, new paper- faced plasterboard, unpainted brick, cement render, fibre cement or masonry. | Apply one coat of Wattyl Ultra Acrylic Sealer Undercoat. |
| Bare timber and MDF. | Apply one coat of Wattyl Ultra Acrylic Sealer Undercoat. On tannin rich timber first apply one coat of Wattyl Ultra Primer Sealer Undercoat. |

wattyl

ULTRA

DATA SHEET

PREMIUM CEILING HIGH OPACITY WHITE

RESOURCE CODE 43151109 APRIL 2024 PAGE 3 OF 3

| Surface Typecontinued | Preparatory CoatsContinued |
|--|---|
| Bare plaster. | Apply one coat of Wattyl Master Prep Pigmented Sealer or Wattyl Acrylic Plaster Sealer. |
| Additional Data | |
| and colour consistency, tinted paint should For ceilings in wet areas or where a wash Wattyl Ultra Interior Satin Acrylic. Avoid exposure to steam and condensatio Containers must be secured and stored up Containers must not be exposed to excess Store in a secure, cool and well ventilated | e colour is suitable for your requirements before application. For best results d be boxed and thoroughly mixed on site. able ceiling finish is required, use Wattyl Ultra Interior Low Sheen Acrylic or on for 48 hours after application of final coat. right during transit. ive heat or cold. blace. Keep container tightly closed. those manufactured by Wattyl is not recommended. |
| Safety Data | |
| 7 If First Aid Instructions If If If If If If | For advice, contact the Poisons Information Centre on 131 126 (Australia), 0800 64 766 (New Zealand), or a doctor. F swallowed, do not induce vomiting. Give a glass of water to drink. F in eyes, wash out immediately with water. F inhaled remove from contaminated area to fresh air. F skin contact occurs, remove contaminated clothing and flush contaminated kin with water. |
| Safety Directions | Keep out of reach of children. Woid contact with skin and eyes. Ensure adequate ventilation during use. Woid prolonged breathing of vapour. Vash hands thoroughly after use. |
| Further Information | For the latest information refer to the Safety Data Sheet available on our vebsites. Australia: www.wattyl.com.au or contact Wattyl Assist on 132 101. New Zealand: www.wattyl.co.nz or contact Wattyl Assist on 0800 825 7727. (Wattyl) Australia and Hempel (Wattyl) New Zealand products. Hempel (Wattyl) Australia and Hempel (Wattyl) |

1. This information is provided with respect to the listed Hempel (Wattyl) Australia and Hempel (Wattyl) New Zealand products. Hempel (Wattyl) Australia and Hempel (Wattyl) New Zealand, hereon referred to as "Hempel (Wattyl)," recommends that:

(a) You review the Technical Data Sheets (TDS) and Safety Data Sheets (SDS) before you use or handle the product; (b) the product be used only in accordance with the information provided by Hempel (Wattyl); (c) the product be transported and handled in accordance with the SDS and relevant TDS; and (d) you thoroughly test the product, using the recommended application method on a sample of intended substrate, before using the product.

2. The information in the TDS was prepared using information gathered during product development. While Hempel (Wattyl) endeavour to update this information and maintain the accuracy of its contents, Hempel (Wattyl) cannot guarantee that the information is wholly comprehensive.

3. Hempel (Wattyl) recommend that you conduct such additional investigations as may be necessary to satisfy yourself of the accuracy, currency and comprehensiveness of the information on which you rely in using and handling the product. If you require further information please contact your nearest office of Hempel (Wattyl).

4. To the full extent permitted by law, the liability of Hempel (Wattyl) for breach of a condition or warranty implied into the contract for sale between Hempel (Wattyl) and you by law is limited at the election of Hempel (Wattyl) to: (a) the replacement of the product; or (b) payment of the cost of replacing the product.

All brands and product names are registered trademarks of Hempel (Wattyl) Australia Pty Ltd ABN 40 000 035 914 and Hempel (Wattyl) New Zealand Pty Ltd 942 904 073 3692.